

Release Note for Vigor2866 Series

Firmware Version:	4.5.3.1
Release Type:	Important – Review release notes and upgrade if the changes affect your system stability, performance, or security
Applied Models:	Vigor2866 / Vigor2866ac / Vigor2866L / Vigor2866Lac / Vigor2866ax / Vigor2866Vac

Vigor2866 Series is a G.fast Security Firewall router integrating a DSL modem which is compatible with variants of DSL protocols, including G.fast, VDSL2 profile 35b Super Vectoring, and ADSL2+.

New Features

- None.

Improvement

- Improved: Updated the Wi-Fi driver with security improvements (CVE-2025-20674, CVE-2026-20452)
- Improved: Improved security by addressing CVE-2025-6965.
- Corrected: An issue where firmware upgrades initiated from VigorACS failed.
- Corrected: An issue where the router randomly rebooted multiple times a day.
- Corrected: An issue where the router would constantly reboot after a firmware upgrade.
- Corrected: An issue where an IKEv2 VPN (NAT mode) connection to a Juniper device disconnected every two hours.

Known Issue

- A firewall can restrict/drop unwanted inbound WAN traffic such as VPN requests. The router's firewall block rules can stop remote management and VPN access. It is recommended to review the firewall settings before upgrading.
- QoS does not work on G.fast line when the link rate exceeds 600 Mbps.
- For "ax" series model:
The wireless clients might encounter unexpected trouble (e.g., unable to use the printer on LAN) while accessing into Internet if the hardware acceleration is enabled.
To skip hardware acceleration for certain devices, the following telnet command can be used:
`ppa -E -e 1`
`ppa -E -a AA:BB:CC:XX:XX:XX nat|bridgelipsec`
- Vigor2866 may have synchronization or performance issues when connecting to the DSL line with a lower SNR value (<6).

File and Modem Code

- "Vigor2866_v4.5.3.1_STD.zip" provides Annex A modem code 123230_02 and 123210_30.
- "Vigor2866_v4.5.3.1_MDM1.zip" provides Annex A modem code 126110_12 and 126010_15.
- "Vigor2866_v4.5.3.1_MDM2.zip" provides Annex A modem code 127210_04. Recommended for

Australian users

- "Vigor2866_v4.5.3.1_MDM3.zip" provides Annex J modem code 127210_04. Recommended for Germany, Austrian and Swiss users
- "Vigor2866_v4.5.3.1_MDM4.zip" provides Annex A modem code 128210_02. Recommended for Australian users
- "Vigor2866_v4.5.3.1_MDM5.zip" provides Annex J modem code 128210_02. Recommended for German users.
- "Vigor2866_v4.5.3.1_MDM6.zip" provides Annex A modem code 129120_05. (Recommended when meeting VDSL sync issue).
- "Vigor2866_v4.5.3.1_MDM7.zip" provides Annex J modem code 129120_05.
VDSL2 Profile 30a is supported by modem code 129120_05(MDM6/MDM7).

Note

- IPsec HMAC (MD5) is no longer supported.