

Release Note for Vigor2866 Series

Firmware Version:	4.5.3.2
Release Type:	Critical – Upgrade immediately to address urgent security issues or major system risks
Applied Models:	Vigor2866 / Vigor2866ac / Vigor2866L / Vigor2866Lac / Vigor2866ax / Vigor2866Vac

Vigor2866 Series is a G.fast Security Firewall router integrating a DSL modem which is compatible with variants of DSL protocols, including G.fast, VDSL2 profile 35b Super Vectoring, and ADSL2+.

New Features

- None.

Improvements

- Improved: Enhance the Web CGI security.
- Improved: Enhance the security by patching OpenSSL against the HollowByte DDoS attack.
- Improved: Adjust the URL for connecting to MyVigor from auth.draytek.com to auth2.draytek.com.
- Corrected: An issue with intermittent reboot caused by VoIP SIP attack.
- Corrected: An issue which the router rebooted when importing config exp file.
- Corrected: An issue which the router rebooted constantly after LTE was configured.
- Corrected: An issue with unexpected system reboot occurred which might be related to L2TP.

Known Issue

- A firewall can restrict/drop unwanted inbound WAN traffic such as VPN requests. The router's firewall block rules can stop remote management and VPN access. It is recommended to review the firewall settings before upgrading.
- QoS does not work on G.fast line when the link rate exceeds 600 Mbps.
- For "ax" series model:
The wireless clients might encounter unexpected trouble (e.g., unable to use the printer on LAN) while accessing into Internet if the hardware acceleration is enabled.
To skip hardware acceleration for certain devices, the following telnet command can be used:
`ppa -E -e 1`
`ppa -E -a AA:BB:CC:XX:XX:XX nat|bridgelipsec`
- Vigor2866 may have synchronization or performance issues when connecting to the DSL line with a lower SNR value (<6).

File and Modem Code

- "Vigor2866_v4.5.3.2_STD.zip" provides Annex A modem code 123230_02 and 123210_30.
- "Vigor2866_v4.5.3.2_MDM1.zip" provides Annex A modem code 126110_12 and 126010_15.
- "Vigor2866_v4.5.3.2_MDM2.zip" provides Annex A modem code 127210_04. Recommended for Australian users

- "Vigor2866_v4.5.3.2_MDM3.zip" provides Annex J modem code 127210_04. Recommended for Germany, Austrian and Swiss users
- "Vigor2866_v4.5.3.2_MDM4.zip" provides Annex A modem code 128210_02. Recommended for Australian users
- "Vigor2866_v4.5.3.2_MDM5.zip" provides Annex J modem code 128210_02. Recommended for German users.
- "Vigor2866_v4.5.3.2_MDM6.zip" provides Annex A modem code 129120_05. (Recommended when meeting VDSL sync issue).
- "Vigor2866_v4.5.3.2_MDM7.zip" provides Annex J modem code 129120_05.
VDSL2 Profile 30a is supported by modem code 129120_05(MDM6/MDM7).

Note

- IPsec HMAC (MD5) is no longer supported.