

Release Note for Vigor3912 Series

Firmware Version:	4.4.6.3
Release Type:	Critical – Upgrade immediately to address urgent security issues or major system risks
Applied Models:	Vigor3912, Vigor3912S

New Features

- None.

Improvement

Reboot / Crash / Freeze / High CPU

- Corrected: An issue in which the router would reboot when an IKEv2 VPN negotiation was split into fragments.
- Corrected: An issue where the router rebooted every 1–1.5 hours, potentially due to a memory leak in the network driver.
- Corrected: An issue where the router crashed after a WireGuard key renewal.
- Corrected: An issue where the router became unresponsive when a LAN host was flooded with traffic from the internet.
- Corrected: An issue where the router rebooted due to the TR-069 connection to the management server.
- Corrected: An issue where the router rebooted due to IGMP logging.
- Corrected: An issue where the router rebooted when HTTPS traffic to MyVigor was blocked upstream.
- Corrected: An issue where the router continuously rebooted due to DDNS.
- Corrected: An issue where the router crashed after L2TP VPN activity.
- Corrected: An issue where the router rebooted under heavy 802.1X (RADIUS) login traffic.
- Corrected: An issue where the router crashed when BitTorrent filtering was applied in a firewall rule.
- Corrected: An issue where the router crashed when applying a wireless profile from Central AP Management.
- Corrected: An issue where the router crashed after repeated wireless mesh resets.
- Corrected: An issue where the router rebooted when importing a configuration file.
- Corrected: An issue where a faulty SFP module kept the port-status service busy on the router.

VPN & Security

- Corrected: An issue where only four WireGuard LAN-to-LAN tunnels could be configured.
- Corrected: An issue where an IPsec VPN connection from a routed LAN stopped working after a few minutes.
- Corrected: An issue causing packet loss and latency on the LAN-to-LAN VPN.
- Corrected: An issue causing IKEv2 EAP VPN connections to fail when using the built-in client on Android 16.
- Corrected: An issue where packets were not NATed on L2TP/IPsec dial-out connections.
- Corrected: An issue causing an incorrect AES-GCM encryption setting in the VPN data path.

- Improved: The VPN Connection Status page shows the IPsec type and DH group.
- Improved: Enhanced access control for pages that can be reached before login.
- Corrected: An issue affecting security in SSH, the login page, EasyVPN OTP mail, and Hotspot.
- Corrected: An issue causing a buffer overflow in NAT > Open Ports.
- Corrected: An issue related to the OpenSSL "HollowByte" denial-of-service flaw
- Corrected: An issue affecting the security of user online-status notifications.

Web UI

- Improved: Add the firmware update prompt mechanism.
- Improved: Increased the maximum PPPoE username length from 24 to 40 characters.
- Improved: A long admin password is now accepted for Telnet login, in addition to the Web UI.
- Corrected: An issue occurred where switching from LAN DNS to DNS Forward did not clear the IP addresses or DNS cache.
- Improved: The same DHCPv6 option can now be added on different LANs.
- Corrected: An issue occurred where Port Knocking did not display a warning when the first knock port was already in use.
- Corrected: An issue occurred where the configuration backup was truncated, and the corrupted file could not be reported.
- Corrected: An issue occurred where SNMPv3 remained effective even after it was disabled.
- Corrected: An issue occurred where enabling or disabling the SNMP agent caused the WAN connection to go down.
- Corrected: An issue occurred where the Data Flow Monitor failed to display the DHCP host name.
- Corrected: An issue occurred where the WAN name was displayed repeatedly on the IPv6 line in System Status.
- Corrected: An issue that the IPv6 uptime wrapping onto a second line on the Dashboard.
- Corrected: An issue with the Central Management >> Switch pages, including missing ports on a 54-port switch.

Others

- Corrected: An issue with User-Based authentication where the time-tracking pop-up reappeared and user accounts were able to log in.
- Improved: Let's Encrypt certificates will be renewed automatically.
- Corrected: An issue where firmware uploads through the Web UI failed part way through.
- Corrected: An issue where the CPE could not connect to MyVigor after the service was migrated to Cloudflare.
- Corrected: An issue where NAT loopback did not work when the Route Policy used a WAN alias IP.
- Corrected: An issue where Smart Action's scheduled reboot did not run every time.
- Corrected: An issue where an unresolved hostname object flooded DNS queries and the log.
- Corrected: An issue where traffic from accelerated L2TP tunnels after the first tunnel was not displayed in the Web UI.
- Improved: Supported the DrayOS CLI option to the Console Menu.
- Improved: Added the "port sniff" telnet command.
- Improved: Hardened alert-message handling.
- Improved: Added logs for LAN packets dropped by the virtual network card for diagnosis.
- Corrected: An issue where wrong port speed and stale port status displayed on the Dashboard.
- Corrected: An issue where the LAN responded to ARP requests for internal Docker addresses, causing confusion on the switch.

Known Issue

- None.

Note

- To comply with NIS2 security requirements, the firmware now applies the following defaults: Telnet is disabled, FTP is disabled, and Enforce HTTPS Access is enabled. If Telnet/ FTP access on LAN1 is unavailable after the upgrade, users are advised to verify the settings under System Maintenance >> LAN Access Control.